

# Test Procedure for the RSL10-002GEVB Evaluation Board

### INTRODUCTION

RSL10 is a multi-protocol Bluetooth 5 certified System on Chip (SoC) which brings ultra-low-power wireless connectivity to IoT and "connected" health and wellness devices.

Assembled RSL10 evaluation board (make note of the 9 jumper positions):



Figure 1: Assembled board.

# SETUP

The following list of equipment is required for testing, see Figure 2:

- 1. A computer with an internet connection and 4 USB ports.
- 2. An ammeter that can measure uA.
- 3. JLink JTAG box with an appropriate 10 pin SEGGER programmer connector.
- 4. 1 micro USB cable for the Device Under Test (DUT).
- 5. 1 DIO testing rig.
- 6. 1 RF enclosure containing a Lower Tester RSL10 board, 80dB fixed attenuators, two SMA adaptor cables, and a USB cable. These additional cables should already be connected to the RF enclosure.





Figure 2: Required hardware for testing.

Inside the RF enclosure (see Figure 3) you can find:

- 1. Extra cables in the ESD bag.
- 2. The Lower Tester board. This board has been characterized by our team and the RF performance is very well documented. The LEDs on the board will be on if the board is powered.
- 3. The conductive RF path.
- 4. The USB connection.



Figure 3: Contents of the RF box.



Insure the following applications are installed into your machine (the application installs can be found in the **Installs** folder). Note, this installation process only needs to be done once.

- 1. Python 2.7
  - a. Navigate to ColoradoProductionTest\Installs\Python\_Installs.
  - b. Run **python-2.7.10.msi**. Follow the normal installation instructions.
  - c. Make sure C:\Python27 is added to the computer's PATH environment variable. See Figure 4.
  - d. Make sure C:\Python27 is added to the computer's PYTHONPATH environment variable. See Figure 5.
  - e. Restart the computer for these changes to take effect.

Variable	Valu	ie	
CMWrunTestsDir	C:\F	Program Files\Rohde-So	chwarz\RUN\
Path	C:\F	Program Files (x86)\CVS	SNT\;C:\Pro
	%U	SERPROFILE%\AppData SERPROFILE%\AppData	\Local\Temp
	<u> </u>	lew Edit	Delete
System variables		Edit User Variable	
Variable	Val		
CMWrunTestsDir	C:\	Variable name:	Path
ComSpec	C:\	Variable value:	xpandable_Framework\tests; C:\
DEFLOGDIR	C:		
FP_NO_HOST_C	NO		ОК

Figure 4: Adding C:\Python27 to the PATH.



Variable	Value		
CMWrunTestsDir	C:\Program Files\Robd	e-Schwarz\RUN\	
Path	C:\Program Files (x86)	CVSNT\:C:\Pro	
TEMP	%USERPROFILE%\App	Data\Local\Temp	
TMP	%USERPROFILE%\App	Data\Local\Temp	
ystem variables Variable PROCESSOR_RE PSModulePath	Variable name: Variable value:	PYTHONPATH xpandable_Framework\tests; C:\P	ythor
TEMP		ОК Са	ncel
	New Edi	Delete	

Figure 5: Adding C:\Python27 to PYTHONPATH.

- 2. Pyserial Library
  - a. Navigate to ColoradoProductionTest\_Bittele\Installs\Python\_Installs.
  - b. Run **installpyserial.bat**. This file will automatically install the required serial libraries. See Figure 6.

ColoradoProductionTest_Bittele   Installs	Python_Installs 🕨	
ary ▼ Share with ▼ New folder		
Nama	Data modified T	T. a
Name	Date modified	i ył
📜 CVS	6/23/2017 4:16 PM F	File
🔁 get-pip.pv	3/6/2017 10:35 AM	Pvt
	5, 5, 2017 10:05 7 10:1	
🧑 installpyserial.bat	6/21/2017 7:00 PM V	Wi
pyserial-3.2.1-py2.py3-none-any.whl	3/6/2017 10:35 AM V	Wŀ
python-2.7.10.msi	3/6/2017 10:36 AM V	Wi

**Figure 6: Install files for Python.** 

- 3. JLink V500i
  - a. Navigate to ColoradoProductionTest\_Bittele\Installs\JLink. See Figure 7.



ColoradoProductionTest_Bittele   Installs  JL	ink 🕨	•
th ▼ New folder		
Name	Date modified	Ту
👢 cvs	6/23/2017 4:16 PM	Fil
🧑 readmac.jlink	6/16/2017 11:42 A	JLI
ntext Setup_JLink_V500i.exe	3/6/2017 10:35 AM	Ap
🧑 test.bin	6/22/2017 9:13 PM	BI
🥑 testdio.jlink	6/21/2017 7:41 PM	JLI
茨 UM08001_JLink.pdf	3/6/2017 10:36 AM	Ac

Figure 7: Install file for the JLink application.

- b. Run Setup\_JLink\_V500i.exe.
- Follow normal install instructions, however, when prompted to select an installation directory, make sure to install it to the **ColoradoProductionTest\_Bittele\Installs\JLink**. Folder. See Figure 8.

過 Choose Destination Locati	on 🛛	
	Setup will install J-Link V5.00i in the following folder.	
	To install into a different folder, click Browse, and select another folder.	
	You can choose not to install J-Link V5.00i by clicking Cancel to exit Setup.	
	Destination Folder C:\\SEGGER\JLink_V500i	
	Select Destination Directory	δ
	[lanufacturing\ <mark>ColoradoProductionTest_Bittele\Installs\JLink</mark>	ОК
	C:\ Program Files (x86)	Cancel
	☐ JLink_V500a ☐ JLink_V500i ☐ JLink_V510d ☐ JLink_V610d	
	, system	

Figure 8: Change the installation path to the JLink folder provided by us.

### PROGRAMMING THE ATMEL

To fully test the board, the Atmel IC on the bottom of the board needs to be programmed. This will allow us to communicate to the board over USB.

- 1. Connect the Device Under Test (DUT) to the laptop with the micro USB cable. This will supply power to the board. See Figure 9. Note that the board does not need to be in the testing jig for this process.
- 2. Connect the JTAG programmer cable to the board in the following configuration:





Figure 9: The Jlink programmer cable connects the board.



Figure 10: Close-up of the 10 pin programming cable.

Note the JTAG cable has guide pins that only allow the connector to be plugged in one way.

3. In the Atmel folder (ColoradoProductionTest\_Bittele\Atmel), run Program\_Atmel.bat. The Segger application will attempt to connect with a remote server over the internet, submit the ON Semi license key, and then load a unique SEGGER JLink image to the Atmel.

Note, after programming the Atmel IC, both on-board green LEDs should turn on. If only one LED is still on, then either the Atmel is not programmed correctly, or there may be bad components on the board.



### TESTING THE BOARD

- 1. First, make sure there is a serial number on the bottom of the board.
- 2. Next place the board into the testing jig and connect the USB. See Figure 11.



Figure 11: Proper placement of the board into the test jig.

3. To begin testing, In the **ColoradoProductionTest\_Bittele** folder, run **colorado\_production\_test.py**, or simply double click **Run\_Test.bat**. When prompted for device ID, input the unique PCB barcode number. This will generate a .txt file in the same folder which will hold detailed information on how each device passed or failed testing.

Follow the text that will appear in-console. At various points during testing you will be prompted to connect the Lower Tester unit to the laptop over USB, reset the device, connect the SMA adaptor etc. At the end of the test a final Pass or Fail will be outputted to the console (as well as the unique .txt file generated).

#### Overview of Tests

An overview of the tests/procedures that are performed one after another:

- 1. An initial erase of the flash memory on the device.
- 2. A check to insure there is a MAC address saved in the device's memory. If there is no MAC address found, the board automatically fails.
- 3. A DIO test that uses the test jig to hold the DUT during testing. See Figure 10. The jig has pogo-pins that connect to all the DIOs on the board and makes sure they are functional. This test will fail if any of the DIOs are shorted or open.
- 4. A 32 kHz external board mounted crystal test. This test runs at the same time as the DIO test. This test will fail the crystal is not within tolerance (**500ppm**) or if it disconnected from the board.



- 5. An RF test that runs a DTM script that requires the Lower Tester FR enclosure to be connected to the laptop.
  - a. The application loaded onto RSL10 will first put the device in DC/DC power mode (testing the inductor and capacitor placement).
  - b. An SMA adaptor cable (coming from the RF Lower Tester Box) is then connected to the DUT. See Figure 12 Make sure you hear/feel a click sounds with connecting the cable. This will tell you that a good connection has been made. Note that after a few hundred cycles, this cable may get old and worn-out. When this happens, use one of the extra cables provided (see Figure 3).
  - c. The test will pass as long as we measure a packet error rate (PER) of less than 30%.



Figure 12: Connecting the RF SMA adaptor cable.

- 6. Loading the final "peripheral-server-sleep" application onto RSL10. The boards will be shipped with this image loaded in flash memory.
- 7. A current measurement test that will require the use of an ammeter connected to the current measure pins. A current draw of less than **500uA** should be read. Ideally you want to use an ammeter that does very little averaging. See Figure 13 and Figure 14:





Figure 13: This jumper is to be removed to make a current measurement. Connect ammeter in series.



Figure 14: Connecting the current measuring cable.
8. Once all other tests have passed without failure, a final PASS will be outputted to the terminal.

NOTE: whenever prompted to reset the device, press the on board reset button. See Figure 15.





Figure 15: Reset button location.

# COMPLETION

Upon completion of the production test, replace the current jumper back onto the current measure pins.

# **Revision History**

Revision	Comments	Release Date	Ву
0.1	Initial revision	2017-02-17	Suril Shah
0.2	Added details + images	2017-03-02	Suril Shah
0.3	Clarified + updated tests (as per MIS request)	2017-03-07	Suril Shah
0.4	Added details for the MAC address assignment procedure	2017-04-27	Suril Shah
1.0	Modified for use with mass production EVB	2017-06-22	Suril Shah
1.1	Updated content as per suggested by the Bittele team.	2017-06-27	Suril Shah